DI1B9-27

DTC	B0108/52	Short in P Squib Circuit (to B+)
-----	----------	----------------------------------

## CIRCUIT DESCRIPTION

The P squib circuit consists of the airbag sensor assembly and front passenger airbag assembly. It causes the SRS to deploy when the SRS deployment conditions are satisfied. For details of the function of each component, see OPERATION on page RS-2. DTC B0108/52 is recorded when a B+ short is detected in the P squib circuit.

DTC No.	DTC Detecting Condition	Trouble Area
	• Short circuit in P squib wire harness (to B+)	Front passenger airbag assembly (P squib)
B0108/52	P squib malfunction	Airbag sensor assembly
	Airbag sensor assembly malfunction	Wire harness

## **WIRING DIAGRAM**

See page DI-271.


## **INSPECTION PROCEDURE**

Prepare for inspection (See step 1 on page DI-390).



1

2 Check P squib circuit.

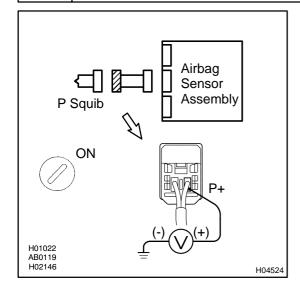

#### **CHECK:**

- (a) Turn the ignition switch to ON.
- (b) For the connector (on the front passenger airbag assembly side) between the front passenger airbag assembly and the airbag sensor assembly, measure the voltage between the P+ and body ground.

OK:

Voltage: 0 V



Repair or replace harness or connector between front passenger airbag assembly and airbag sensor assembly.


ОК

2002 ECHO (RM884U)

Author: Date: 451

3

## Check airbag sensor assembly.

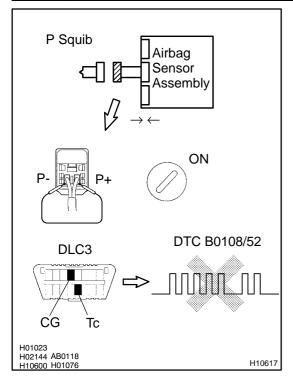

## **PREPARATION:**

- (a) Connect the connector to the airbag sensor assembly.
- (b) Using a service wire, connect P+ and P- of the connector (on the front passenger airbag assembly side) between the front passenger airbag assembly and the airbag sensor assembly.
- (c) Connect negative (-) terminal cable to the battery, and wait at least for 2 seconds.

#### CHECK:

- (a) Turn the ignition switch to ON and wait at least for 20 seconds.
- (b) Clear DTC stored in memory (See step 5 on page DI-239).
- (c) Turn the ignition switch to LOCK, and wait at least for 20 seconds.
- (d) Turn the ignition switch to ON, and wait at least for 20 seconds
- (e) Check DTC (See page DI-239).

#### OK:

## DTC B0108/52 is not output.

#### HINT:

Codes other than code B0108/52 may be output at this time, but they are not relevant to this check.

NG


Replace airbag sensor assembly.

OK

2002 ECHO (RM884U)

Author: Date: 452

# 4 Check P squib.

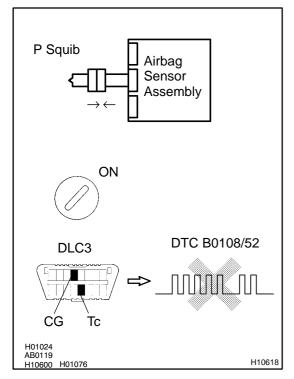

#### **PREPARATION:**

- (a) Turn the ignition switch to LOCK.
- (b) Disconnect negative (-) terminal cable from the battery, and wait at least for 90 seconds.
- (c) Connect the front passenger airbag assembly connector.
- (d) Connect negative (-) terminal cable to the battery, and wait at least for 2 seconds.

#### CHECK:

- (a) Turn the ignition switch to ON, and wait at least for 20 seconds.
- (b) Clear DTC stored in memory (See step 5 on page DI-239).
- (c) Turn the ignition switch to LOCK, and wait at least for 20 seconds.
- (d) Turn the ignition switch to ON, and wait at least for 20 seconds.
- (e) Check DTC (See page DI-239).

#### OK:

## DTC B0108/52 is not output.

## HINT:

Codes other than code B0108/52 may be output at this time, but they are not relevant to this check.

NG

Replace front passenger airbag assembly.



From the results of the above inspection, the malfunctioning part can now be considered normal. To make sure of this, use the simulation method to check. If the malfunctioning part can not be detected by the simulation method, replace all SRS components including the wire harness.

2002 ECHO (RM884U)

Author: Date: 453